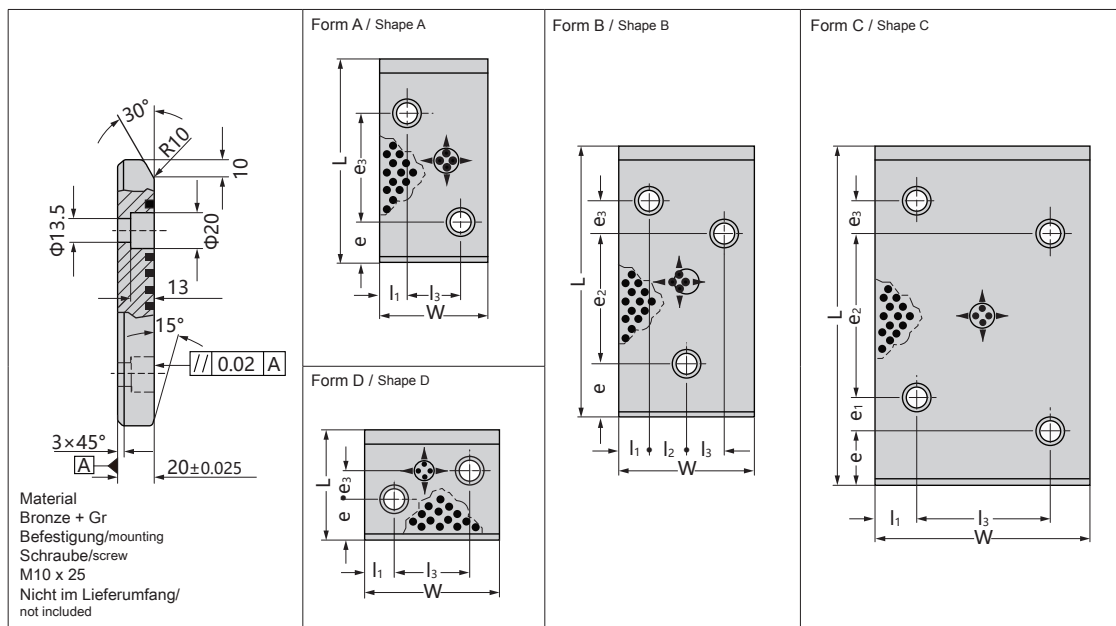


NTAG


Katalog-Nr. / Catalog No.	Form / Shape	W	L	I ₁	I ₂	I ₃	e	e ₁	e ₂	e ₃	Bohrungen / Holes
NTAG50 -100	A	50	100	25	—	—	30	—	—	30	2
150	A	50	150	25	—	—	30	—	—	80	2
200	A	50	200	25	—	—	40	—	—	120	2
NTAG80-100	A	80	100	20	—	40	30	—	—	30	2
150	A	80	150	20	—	40	30	—	—	80	2
200	A	80	200	20	—	40	40	—	—	120	2
250	A	80	250	20	—	40	40	—	—	170	2
315	B	80	315	20	20	20	40	—	210	25	3
NTAG100-50	D	100	50	22	—	56	14	—	—	13	2
80	D	100	80	22	—	56	30	—	—	20	2
100	A	100	100	22	—	56	30	—	—	30	2
150	A	100	150	22	—	56	30	—	—	80	2
200	B	100	200	22	28	28	40	—	95	25	3
250	B	100	250	22	28	28	40	—	145	25	3
315	B	100	315	22	28	28	40	—	210	25	3
NTAG125-80	D	125	80	25	—	75	30	—	—	20	2
100	A	125	100	25	—	75	30	—	—	30	2
150	A	125	150	25	—	75	30	—	—	80	2
200	B	125	200	25	37	38	40	—	95	25	3
250	B	125	250	25	37	38	40	—	145	25	3
315	C	125	315	25	—	75	40	25	185	25	4
NTAG 160-100	A	160	100	30	—	100	30	—	—	30	2
150	A	160	150	30	—	100	30	—	—	80	2
200	B	160	200	30	50	50	40	—	95	25	3
250	C	160	250	30	—	100	40	25	120	25	4
315	C	160	315	30	—	100	40	25	185	25	4


Bestellnummer / Order Number

Bestellung / Order

Katalog-Nr. / Catalog No. - L

NTAG50 - 100

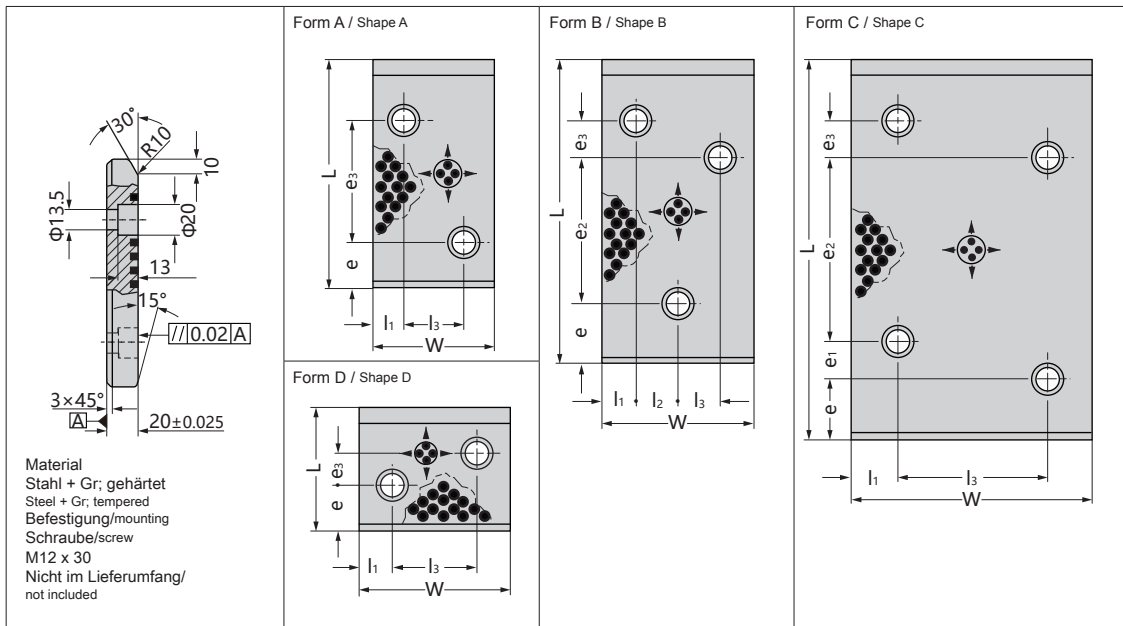

NGAG


Katalog-Nr. / Catalog No.	Form / Shape	W	L	l ₁	l ₂	l ₃	e	e ₁	e ₂	e ₃	Bohrungen Holes
NGAG50 -100	A	50	100	25	—	—	30	—	—	30	2
150	A	50	150	25	—	—	30	—	—	80	2
200	A	50	200	25	—	—	40	—	—	120	2
NGAG80 -100	A	80	100	20	—	40	30	—	—	30	2
150	A	80	150	20	—	40	30	—	—	80	2
200	A	80	200	20	—	40	40	—	—	120	2
250	A	80	250	20	—	40	40	—	—	170	2
315	B	80	315	20	20	20	40	—	210	25	3
NGAG100 -50	D	100	50	22	—	56	14	—	—	13	2
80	D	100	80	22	—	56	30	—	—	20	2
100	A	100	100	22	—	56	30	—	—	30	2
150	A	100	150	22	—	56	30	—	—	80	2
200	B	100	200	22	28	28	40	—	95	25	3
250	B	100	250	22	28	28	40	—	145	25	3
315	B	100	315	22	28	28	40	—	210	25	3
NGAG 125 -80	D	125	80	25	—	75	30	—	—	20	2
100	A	125	100	25	—	75	30	—	—	30	2
150	A	125	150	25	—	75	30	—	—	80	2
200	B	125	200	25	37	38	40	—	95	25	3
250	B	125	250	25	37	38	40	—	145	25	3
315	C	125	315	25	—	75	40	25	185	25	4
NGAG 160-100	A	160	100	30	—	100	30	—	—	30	2
150	A	160	150	30	—	100	30	—	—	80	2
200	B	160	200	30	50	50	40	—	95	25	3
250	C	160	250	30	—	100	40	25	120	25	4
315	C	160	315	30	—	100	40	25	185	25	4


Bestellnummer / Order Number

Bestellung / Order: -
NGAG50 - **100**





NGAS

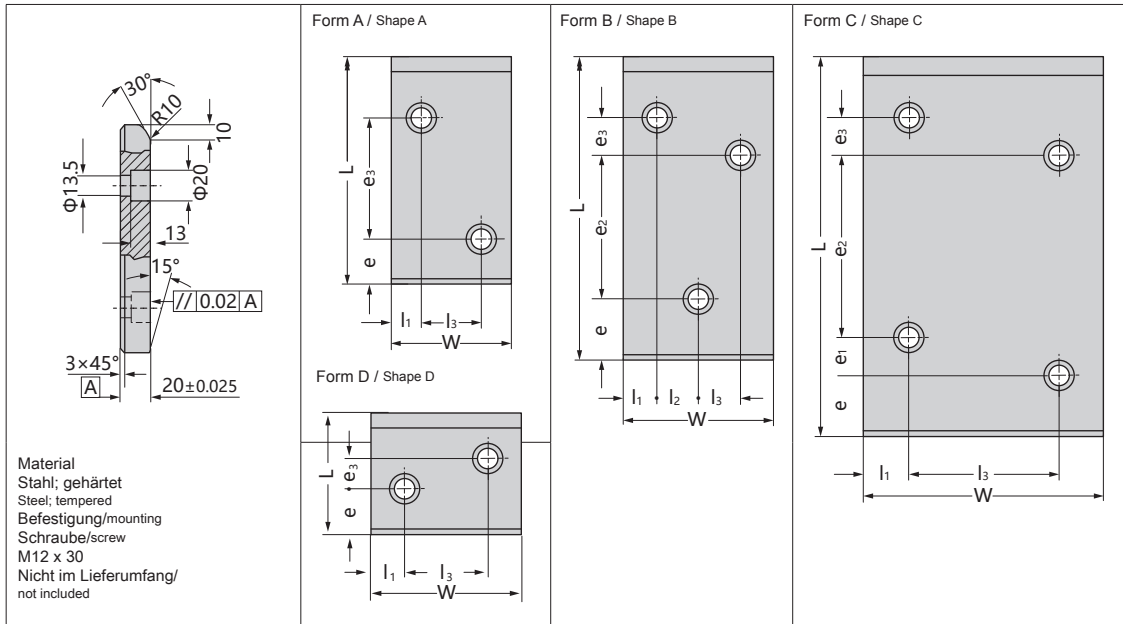

Katalog-Nr. / Catalog No.	Form / Shape	W	L	I ₁	I ₂	I ₃	e	e ₁	e ₂	e ₃	Bohrungen / Holes
NGAS50 -100	A	50	100	25	—	—	30	—	—	30	2
150	A	50	150	25	—	—	30	—	—	80	2
200	A	50	200	25	—	—	40	—	—	120	2
NGAS80 -100	A	80	100	20	—	40	30	—	—	30	2
150	A	80	150	20	—	40	30	—	—	80	2
200	A	80	200	20	—	40	40	—	—	120	2
250	A	80	250	20	—	40	40	—	—	170	2
315	B	80	315	20	20	20	40	—	210	25	3
NGAS 100 -50	D	100	50	22	—	56	14	—	—	13	2
80	D	100	80	22	—	56	30	—	—	20	2
100	A	100	100	22	—	56	30	—	—	30	2
150	A	100	150	22	—	56	30	—	—	80	2
200	B	100	200	22	28	28	40	—	95	25	3
250	B	100	250	22	28	28	40	—	145	25	3
315	B	100	315	22	28	28	40	—	210	25	3
NGAS 125-80	D	125	80	25	—	75	30	—	—	20	2
100	A	125	100	25	—	75	30	—	—	30	2
150	A	125	150	25	—	75	30	—	—	80	2
200	B	125	200	25	37	38	40	—	95	25	3
250	B	125	250	25	37	38	40	—	145	25	3
315	C	125	315	25	—	75	40	25	185	25	4
NGAS160-100	A	160	100	30	—	100	30	—	—	30	2
150	A	160	150	30	—	100	30	—	—	80	2
200	B	160	200	30	50	50	40	—	95	25	3
250	C	160	250	30	—	100	40	25	120	25	4
315	C	160	315	30	—	100	40	25	185	25	4

Bestellnummer / Order Number

Bestellung / Order: -
NGAS50 - 100

